


2019 BMW 540i Sedan (G30) L6-3.0L Turbo (B58M)

Vehicle > Engine, Cooling and Exhaust > Engine > Engine Lubrication > Engine Oil > Service and Repair > Procedures


REPLACE OIL FILTER ELEMENT [REP-TAT-P-1142-25-B58]

Replace oil filter element

REP-TAT-P-1142-25-B58

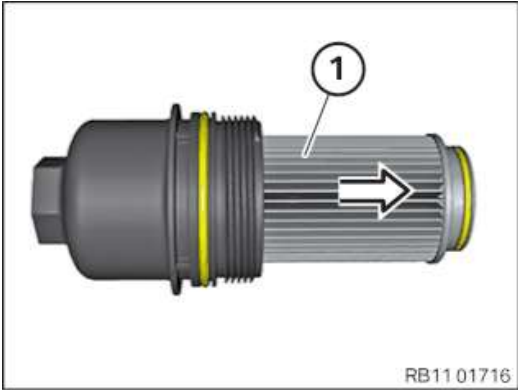

- Loosen the oil filter element (1) from the oil filter cover in the direction of the arrow.

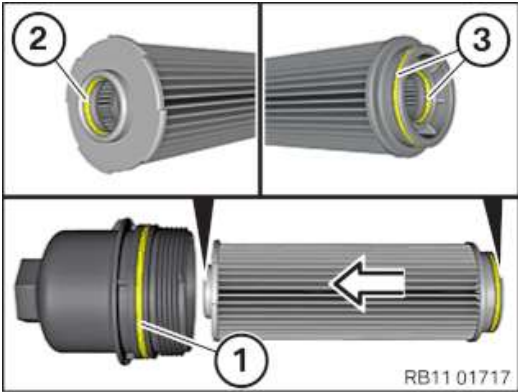

- Renew O-ring (1) and coat with motor oil.
Parts: O-ring
- Coat O-ring (2) with motor oil.
- Coat both O-rings (3) with motor oil.
- Push the oil filter element into the oil filter cover (1).
The oil filter element must snap audibly into place.

Engine Oil Service		
Back To Step 4	Step 5 of 11	Go To Step 6